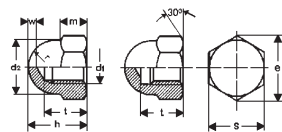


Hutmuttern

hohe Form

Ecrous borgnes

forme haute

aus Stahl
verzinkt-blauen acier
zingué-bleu


d 1	d 2 min.	e min.	h	t	m	s	100	1000
M 3	5,0	6,08	6	4	3	5,5	15.—	9.90
M 4	6,5	7,74	8	5	4	7	17.—	11.20
M 5	7,5	8,87	10	6	5	8	20.40	13.20
M 6	9,5	11,05	12	8	5	10	25.80	16.80
M 8	12,5	14,38	15	11	6,5	13	41.20	30.20
M 10	16,0	18,90	18	13	8	17	79.50	57.—
M 12	18,0	21,10	22	16	10	19	129.—	94.50
(M 14)	21,0	24,49	25	18	11	22	199.—	150.—
M 16	23,0	26,75	28	21	13	24	245.—	180.—
M 20	28,0	33,53	34	26	16	30	462.—	343.—
M 24	34,0	39,98	42	31	19	36	917.—	
M 27	40,0	47,30	47	36	20	41	1'795.—	
							100	
							50	

Hutmuttern

niedrige Form

Ecrous borgnes

forme basse

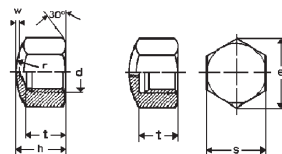aus Stahl
verzinkt-blauen acier
zingué-bleu

d	e min.	h	r	s	t	w min.	100	1000
M 3	6,08	6	7	5,5	3,8	0,8	15.30	11.50
M 4	7,74	5,5	8	7	4,4	1,0	16.40	12.30
M 5	8,87	7	10	8	5,2	1,0	20.10	15.20
M 6	11,05	9	12	10	7,0	1,5	25.10	18.90
M 8	14,38	12	15	13	9,5	2,0	41.—	30.90
M 10	18,90	14	20	17	11,0	2,0	80.—	60.50
M 12	21,10	16	25	19	13,5	2,0	125.—	94.50
(M 14)	24,49	18	28	22	15,0	2,0	232.—	174.—
M 16	26,75	20	30	24	17,0	2,0	237.—	179.—
(M 18)	30,14	22	32	27	19,0	2,0	414.—	312.—
M 20	33,52	25	35	30	21,0	2,5	454.—	341.—
(M 22)	35,72	28	35	32	22,0	3,0	900.—	
M 24	39,98	30	40	36	24,0	3,0	900.—	
							100	
							50	